



# SILVER SPORT *Transmissions*



## HYDRAULIC SLAVE KIT INSTRUCTIONS FOR FORD TR-4050 WITH ADAPTER PLATE

**BEFORE INSTALLING TRANSMISSION IN VEHICLE, YOU MUST CHECK THE  
HYDRAULIC BEARING CUSHION MEASUREMENT!!!**

**SEE PAGE 5 OF INSTALLATION MANUAL FOR INSTRUCTIONS ON  
MEASURING HYDRAULIC BEARING CUSHION. RECORD THIS  
MEASUREMENT FOR FUTURE REFERENCE.**

**DAMAGE WILL OCCUR IF MEASUREMENT IS  
INCORRECT!!!**

The material herein is the intellectual property of Silver Sport Transmissions ("SST") and is to be used by SST customers or their authorized installers for the sole purpose of installing SST-supplied transmissions and related parts. Under no circumstances shall the manual or any portion thereof be copied, duplicated, distributed or incorporated in any written or printed document without the express written approval of Silver Sport Transmissions.

## **SYSTEM DESCRIPTION:**

This system uses the original factory oem firewall-mounted hydraulic master cylinder with an adaptor and a combination slave cylinder/release bearing assembly. This combination bearing is called a concentric slave cylinder (CSC) and **it is designed to be in constant contact with the pressure plate fingers.** The CSC is compressed by the pressure plate fingers when at rest. When the clutch pedal is depressed, the master cylinder forces fluid into the CSC, causing it to expand and depress the pressure plate fingers, thereby releasing the clutch.

This system works best with **DOT 4** brake fluid, **even though the reservoir lid says DOT 3.** **DO NOT use DOT 5 brake fluid!** The seals in the CSC are not compatible with DOT 5 fluid, and will be ruined on contact with it. We recommend using a high-performance, extra-high-temp name brand **DOT 4** brake fluid from ATE, Wilwood, or others.

This system is engineered for use with a diaphragm-style pressure plate and is not compatible with some three-finger style pressure plates. It is recommended that you remove the over-center spring (if equipped) from the clutch pedal when using a diaphragm-style pressure plate.

## **KIT CONTENTS**

Please confirm that all parts have been received.

The parts in your Slave Cylinder kit are:

The parts contained in your Slave Cylinder kit are:

- transmission front bearing retainer & locating stud
- combination slave cylinder/release bearing (CSC)
- braided steel hose with bleeder
- M6-1X16mm socket head cap screws (2)
- spacer plates (if required for application)

If the hydraulic kit was ordered at the same time as the transmission, then your CSC will be placed on the front of the transmission.



## **DISASSEMBLY**

Remove original clutch linkages, transmission and bellhousing components:

- Fork push rod, clutch pedal push rod assembly
- Z-bar retaining clip, Z-bar, ball stud and bracket assembly
- Fork boot
- Drive shaft
- Shifter Handle and Shift Mechanism (if 3 or 4 speed equipped)
- Transmission and bellhousing
- Throw-out bearing, clutch fork and fork pivot

## **MASTER CYLINDER MOUNTING**

See the instructions for the master cylinder kit.

## **SLAVE CYLINDER MOUNTING**

**NOTE :** On these transmissions, the “bearing retainer” is solely used as a mount for the CSC. It is completely external to the transmission and does not contain the input shaft bearing or oil seal.


1. Position the new bearing retainer so that the locating stud is at the top (12 o'clock) position and attach it to the transmission using two (2) M6-1X16mm socket head cap screws. Torque the socket head cap screws to 92 in lbs.
2. Install bellhousing to engine in order to perform the crankshaft alignment check and make corrections if required per instructions MAA-00101.
3. Remove the bellhousing, install the clutch disk along with the pressure plate.
4. Continue with the remainder of your hydraulic clutch kit installation.

## HYDRAULIC BEARING CUSHION MEASUREMENT


The CSC is designed to be compressed by more than  $\frac{1}{2}$ " by the pressure plate fingers when at rest. The CSC needs a minimum of  $\frac{1}{8}$ " cushion beyond that to allow for clutch disc wear and expansion from heat. Clutch slippage will result if the CSC bottoms out and is partially depressing the pressure plate fingers at rest. The cushion measurement procedure below tells you how far the CSC is away from being completely bottomed out. The acceptable range for the CSC cushion is **between  $\frac{1}{8}$ " (0.125") and  $\frac{3}{8}$ " (0.375")**.

1. With the correct clutch pressure plate and clutch disc mounted and torqued to the flywheel, install the bellhousing to the engine with two (2) bolts.
2. Use a straight edge and a steel rule to measure from the transmission mounting face of the bellhousing to the surface of the clutch fingers that contacts the release bearing. Record this depth measurement ( **X** ). Then, remove the bellhousing.

FIG. K

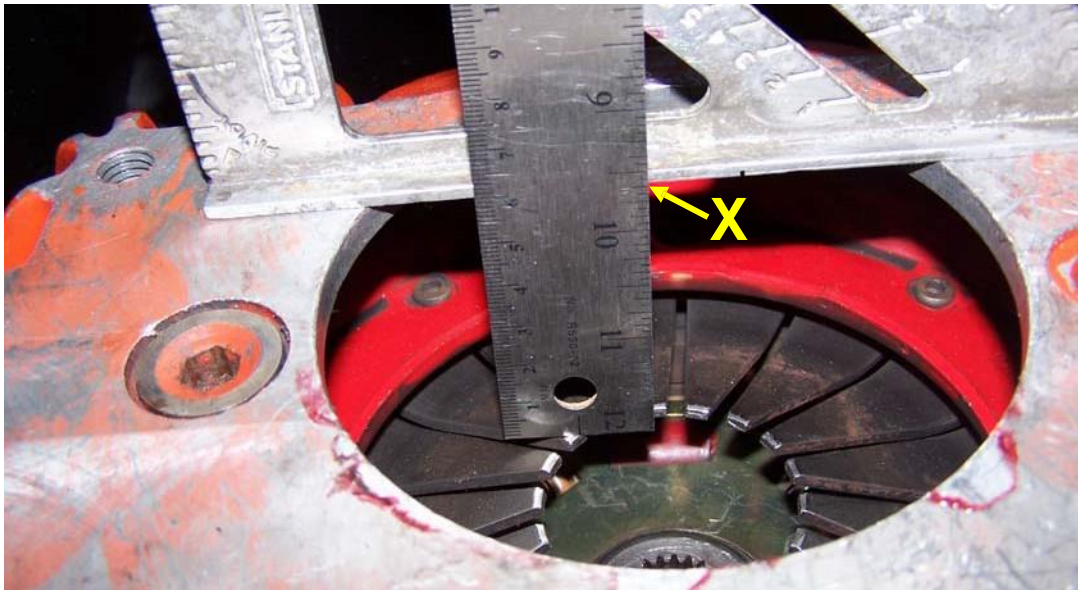

3. Next, with the slave cylinder mounted on the transmission, compress the CSC against its internal spring pressure back towards the transmission. With the CSC compressed to its internal stop (completely bottomed out), hold a straight edge across the face of the throw-out bearing and measure the distance from the face of the bearing to the bellhousing mounting face of the transmission. Record this dimension ( **Y** ).

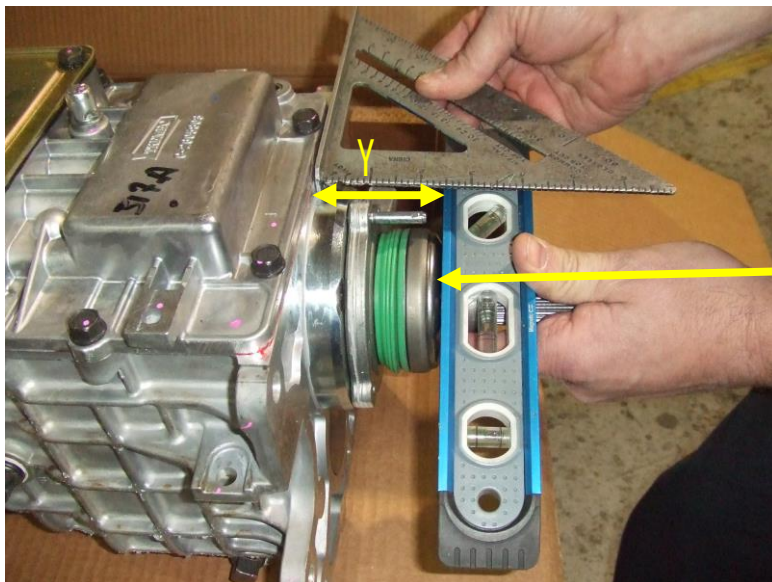

**MEASURE FROM THE FRONT OF THE TRANSMISSION CASE TO THE SURFACE OF THE FULLY COLLAPSED BEARING FOR YOUR "Y" DIMENSION.**

**BEARING FULLY COLLAPSED**

4. Your depth measurement ( **X** ) minus the compressed bearing height ( **Y** ) is your bearing cushion:

$$\underline{\underline{( X ) - ( Y ) = CUSHION}}$$

5. The resulting cushion dimension should be at least 1/8" (0.125"), but no more than 3/8" (0.375"). Anywhere within this range is acceptable. There is no advantage or disadvantage to being at the upper or lower end of the range, or even in the middle. The CSC will function exactly the same way, no matter where it lies within this range.

**If your cushion measurement is outside of this range, you will need one or more spacers to adjust the position of the CSC.**

Call Silver Sport Transmissions to obtain spacers if needed. **Damage WILL result from an incorrect cushion dimension.**

If your cushion measurement is **MORE** than 3/8", you will need one or more CSC spacers to move the CSC closer to the engine block. The spacers are 1/4" thick, and are mounted between the CSC and the input shaft bearing retainer. This is somewhat common with LS series engines.

**CSC SPACER**



**INSTALL SPACERS IF NEEDED**



**\*\*\*\*\* NOTE: The bearing cushion will also need to be re-measured and recalculated after resurfacing or replacing the flywheel, or changing the bellhousing, engine, or clutch. Different clutches have different stack-up heights, and a scattershield is often deeper than a factory GM bellhousing.**

## TRANSMISSION MOUNTING WITHOUT ADAPTER PLATE

1. Place bellhousing onto the transmission while it is setting upright. Install four (4) mounting bolts to align bellhousing with the transmission mounting face.

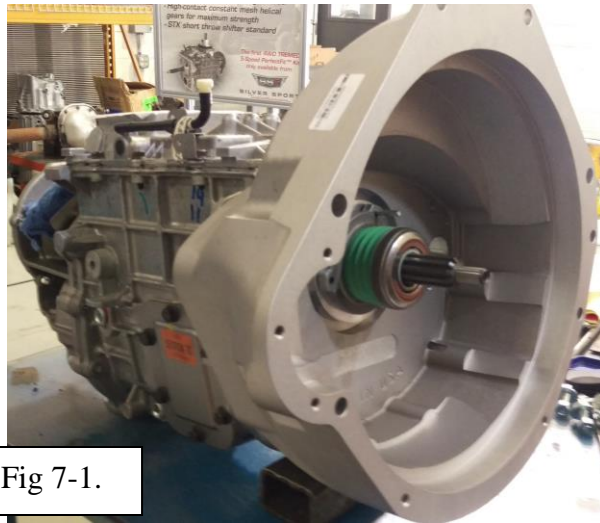


Fig 7-1.

2. Insert hydraulic line from outside of bellhousing and start threading into the throw-out bearing.

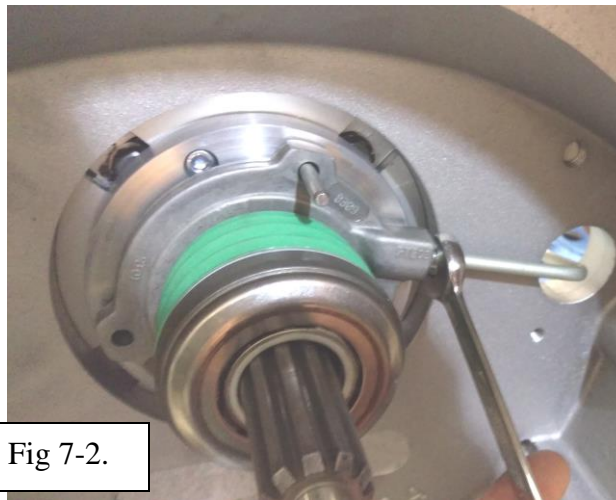


Fig 7-2.



Fig 7-3.

**NOTE: Be very careful not to cross-thread the fitting when doing this!**

3. Tighten the line with it centered in the opening of the bellhousing. Install the cover plate on the outside of the bellhousing with the grommet and 2 mounting screws.
4. Install the bellhousing and transmission with the attached hydraulic bearing and assembled line to the engine. Torque the bolts to factory service manual specifications.

5. After assembly make sure the bearing is seated by checking it through the inspection window.



Fig 8-1.

6. Connect the flexible hydraulic line to the hard line.

### **TRANSMISSION MOUNTING WITH ADAPTER PLATE**

1. Align adapter plate up to bellhousing and start the socket head bolts in the countersunk holes.



Fig 8-2.

2. Remove the bearing retainer from the front of the transmission.

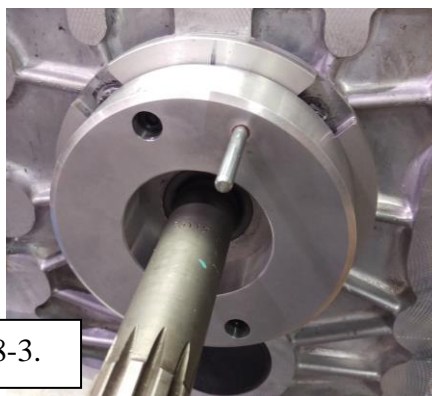


Fig 8-3.

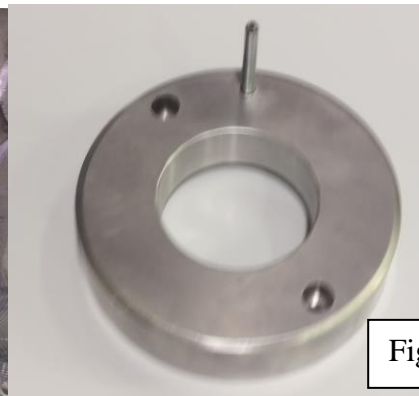


Fig 8-4.

3. Insert the bearing retainer into the bellhousing and adapter plate assembly, making sure to engage the bell and the adapter with the bearing retainer and tighten the 4 adapter plate bolts (Figure 10.1).

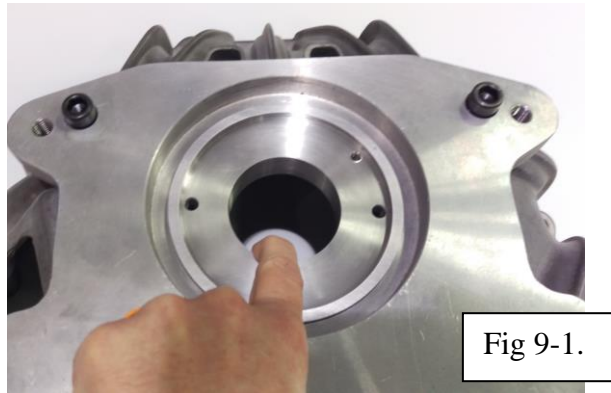


Fig 9-1.

4. Reinstall the bearing retainer onto the transmission using the (2) m6 bolts.
5. Replace the spacers and csc bearing to get the cushion measurements described on page 5.

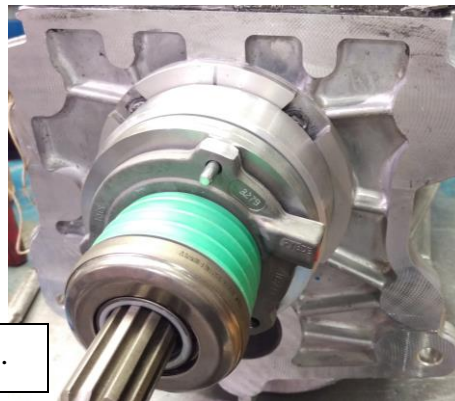


Fig 9-2.

6. Assemble the bellhousing with adapter plate to the engine to get the cushion measurements described on page 5.
7. Remove bellhousing and adapter plate from engine and assemble to the transmission. The spacers and CSC bearing will have to be removed and then reinstalled to the transmission after the bellhousing is put on.
8. Assemble line to CSC bearing and tighten fittings.

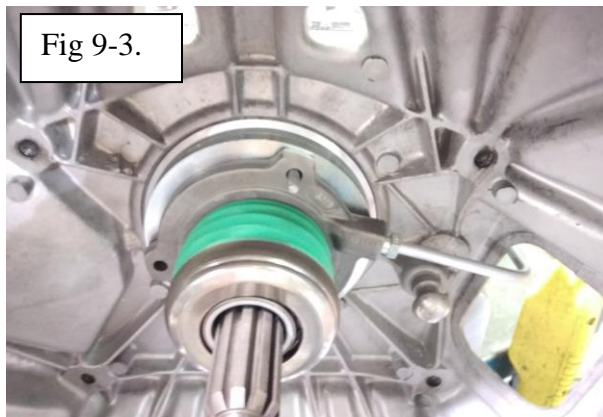


Fig 9-3.

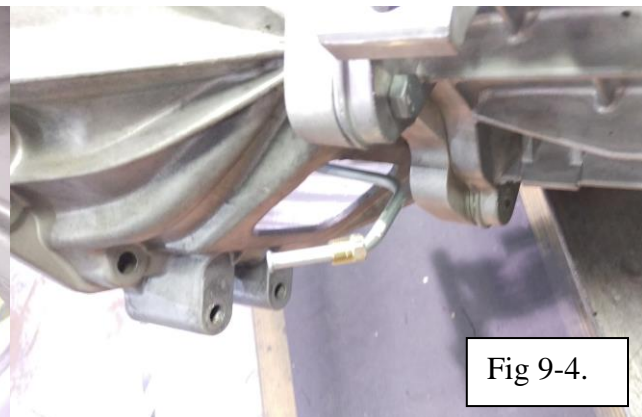


Fig 9-4.

9. Install the bellhousing and transmission with the attached hydraulic bearing and assembled line to the engine. Torque the bolts to factory service manual specifications.

## HYDRAULIC HIGH PRESSURE HOSE MOUNTING

1. After bolting the transmission/bellhousing unit to the engine, attach the remaining end of the braided steel line to the clutch master cylinder adaptor and tighten. Use caution not to over tighten and break the fitting.
2. Final tighten all transmission mounting bolts (4 pcs).
3. Inspect the supply line inside bellhousing and confirm the hoses have ample clearance to the rotating clutch plate. It is extremely important that the hydraulic clutch hose **DOES NOT** come into contact with the clutch plate, as serious damage could result.

## **HYDRAULIC FLUID FILL & BLEED – ON CAR**

You will need two people to bleed this clutch system when installed on the vehicle. Use caution to prevent brake fluid from contacting paint, as damage will likely occur. If your vehicle has an over-center spring installed, it will tend to hold the clutch pedal to the floor until the system is bled enough to return the pedal itself. Remove reservoir cap from the reservoir.

1. Fill the reservoir full with **DOT 4 brake fluid**. During the next steps check regularly to **make sure that the reservoir does not run out of fluid**. If this happens you will have to start the process over.
2. Open the line at the bell housing to allow air to escape from the system. Give the fluid a few minutes to make its way down to the fitting, while watching the fluid level in the reservoir and refilling as necessary. Allow fluid to drip from the fitting into a suitable container.
3. It may be necessary to prime the master cylinder by removing the high pressure hose at the master cylinder and block the fitting outlet to draw fluid into the cylinder when stroking the pedal. When the cylinder is primed, reattach the pressure line and continue the bleeding procedure. Take care not to spill brake fluid on any painted surfaces.
4. When the drip becomes a steady stream, close the fitting. Refill the fluid reservoir. Open the fitting slightly and have your helper depress the pedal **slowly**. Close the fitting as soon as the pedal reaches the floor. Then have your helper **slowly** release the pedal. **Pressing or releasing the pedal too quickly will cause brake fluid to squirt from the top of the reservoir**. The pedal may need to be manually pulled up from the floor during these steps. Repeat this process several times, refilling the reservoir every 3 strokes or so.
5. When the fitting stops spitting air, close and tighten the fitting. Pump the pedal several times to check for proper feel. Repeat the process if the pedal is not firm throughout its travel, or if it seems that the clutch is not releasing fully. Make sure that the master cylinder pushrod is traveling its full stroke of 1.5" (1-1/2") and that **the master cylinder is fully extended when the clutch pedal returns to its home position (no tension on the pushrod with the clutch pedal all the way up)**.
6. **VACUUM BLEEDING PROCEDURE:** If bleeding proves difficult for one reason or another, a manual vacuum bleeder can be used to draw a vacuum on the reservoir and thereby the entire system and pull trapped air into the reservoir. With the rubber baffle removed from the reservoir and the cap installed, apply vacuum to the vent hole in the center of the cap. You may try stroking the pedal while vacuum is being applied. Repeat until the system is bled. It may take 20-30 minutes or even more in order for the vacuum method to get all the air out of the system.
7. Upon successful bleeding, fluid level will need to be lowered to approximately 1/3 full. Excess fluid may be removed from the reservoir by siphoning with a hand-held vacuum pump or with a spoon or medicine cup. Reinstall rubber baffle and cap.
8. Inspect for leaks, and replace the bellhousing inspection cover.
9. Check fluid level and add if necessary after the first test drive or after vehicle sits overnight.

**NOTE: It may be necessary to bleed the clutch again after minimal use, as operation may dislodge some trapped air.**

## INSPECTION AND TESTING

**USE EXTREME CAUTION WHEN TESTING CLUTCH RELEASE SYSTEM.  
DO NOT TEST IN HIGH TRAFFIC OR PUBLIC AREAS.**

### ENGINE-OFF TEST

With the parking brake set, test the release and engagement of the clutch mechanism. Check for the following:

1. Clutch pedal completely up at its home position when released, and that the **master cylinder pushrod is fully extended** when the pedal is all the way up.
2. Clutch pedal does not hit brake lamp bracket or other bracket.
3. Low resistance for initial travel when depressing clutch pedal. Clutch resistance increasing at 1/3 of full stroke and remaining approximately constant through full travel to the floor.
4. Clutch pedal travel to floor without over-travel of clutch plate. Over-travel is characterized by a sudden hard pedal. This should not be a problem if the "Hydraulic Bearing Cushion Measurement" was accurately made.
5. Clutch pedal travel to floor without bottoming out hydraulic bearing. Bottoming out is characterized by a sudden high pressure required to exert further pedal stroke. If this condition occurs, damage to the master cylinder seals or slave cylinder may result from continued operation. **NOTE: The hydraulic slave cylinder has approximately 7/8 inch total stroke, minus the cushion that was measured earlier. Most clutches release within 1/2 inch travel.**
6. Smooth system operation with no abnormal noises.

### ENGINE-ON TEST:

Hold brake, place transmission in neutral, start engine. Achieve idle of 1000 rpm or less.

1. Depress clutch pedal.
2. Ease shifter into first gear. **CAUTION:** If grinding occurs, pull back to neutral and stop engine. Repeat bleeding process and verify that the master cylinder pushrod is moving a full 1.5" (1-1/2").
3. Slowly release clutch pedal while maintaining brake pedal pressure. Confirm engine is being loaded as clutch pedal is released.
4. Repeat test step 1-3 through all gears, including reverse.

## **CARE AND MAINTENANCE**

Your SST hydraulic clutch actuator system is designed to give you years of trouble-free service. In order to maximize the life of the system:

- Periodically check fluid level, hose clamps and hoses for damage.
- Flush the hydraulic fluid every 2 years with new, clean **DOT 4** brake fluid.

## **SYSTEM SPECIFICATIONS**

Master cylinder: Bore = 0.709"  
Stroke = 1.500"

CSC: Stroke = .910" total available travel

Fluid: DOT 3 brake fluid is acceptable, **DOT 4** is strongly recommended. **DO NOT USE DOT 5 FLUID.**

### **CONTACT INFORMATION**

SILVER SPORT TRANSMISSIONS  
2250 STOCK CREEK BOULEVARD  
ROCKFORD, TENNESSEE 37853-3043

Phone: (865) 609-8187  
Toll Free: (888) 609-0094  
Fax: (865) 609-8287

[WWW.SHIFTSST.COM](http://WWW.SHIFTSST.COM)

*SILVER SPORT TRANSMISSIONS IS DEDICATED TO YOUR SATISFACTION AND ENJOYMENT OF THIS PRODUCT. PLEASE SEND US PICTURES OF YOUR CAR ALONG WITH A TESTIMONIAL OF HOW YOU RATE THIS PRODUCT. WE WILL BE POSTING MANY CUSTOMER FEEDBACK LETTERS AND PICTURES ON OUR WEBSITE AND BROCHURES.*

**ENJOY YOUR SILVER SPORT  
TRANSMISSION SYSTEM!**

# TROUBLESHOOTING GUIDE

If you are having any sort of problem with the hydraulic system, the first step is to **review the “Hydraulic Bearing Cushion Measurement”** procedure starting on page 7, and verify that you have the correct amount of cushion (1/8” – 3/8”). Do this before going ANY further into the installation.

## DIFFICULTY BLEEDING, FLUID WILL NOT FLOW, CAN'T GET ALL THE AIR OUT, CLUTCH WON'T FULLY RELEASE:

Review the bleeding procedure. Verify:

- That the master cylinder pushrod is **fully extended** when the clutch pedal is all the way up. If there is any tension on the pushrod and the pushrod does not come all the way out, it can close off the fill port in the master cylinder, and fluid will not be able to flow from the reservoir to the master cylinder. **This condition can also cause the CSC to overextend and fail.**
- That you are getting a full 1.5” (1-1/2”) of stroke out of the pushrod itself. If not, then the pushrod extension may need to be adjusted, the master cylinder may need to be repositioned on the firewall, or it may be that the pushrod needs to be connected to a different spot on the pedal. If you change the mount position or connection point, make sure that the pushrod still ends up traveling in a straight line into the master cylinder.
- Make sure the firewall is not flexing. If you measure at the pedal arm and the pushrod is moving 1-3/8”, but the firewall is flexing 1/4”, then you are actually only getting 1-1/8” of stroke.
- If you are using a reservoir that did not come from us, make sure the lid is vented. Some aftermarket reservoirs do not have a vented lid, and this will prevent the system from self-adjusting or bleeding properly.
- If you are using a master cylinder that didn't come from SST, it may be too small. Any master cylinder you use must displace nearly the same amount of fluid as ours in order for it to work properly. Our master cylinder has a 0.750” bore and a 1.4” stroke. If you go with a larger diameter bore, it will INCREASE the amount of pedal effort required and require a shorter stroke; a smaller bore will DECREASE the pedal effort, but require a longer stroke.
  - A master cylinder with a 5/8 (0.675)” bore needs a 2.1” stroke to be compatible with our CSC
  - A master cylinder with a 7/8 (0.875)” bore needs a 1.1” stroke to be compatible with our CSC
- Other, non-hydraulic problems can prevent the clutch from releasing. If the clutch disc is too large in diameter for the pressure plate, it could be pinched. The tip of the input shaft could be bottomed out in the crankshaft. The clutch disc could have gotten contaminated and could be stuck to the pressure plate or flywheel. The pilot bearing could be frozen.

## HIGH PEDAL EFFORT

- The most common cause for a high pedal effort is having the pushrod connected too low on the pedal. Moving the pushrod connection point up closer to the pedal pivot point will reduce the pedal effort. Doing this may also require that the master cylinder be repositioned.
- If the pushrod is not straight in line with the master cylinder, that will also cause increased pedal effort and will wear the master cylinder prematurely.
- Make sure there are no kinks in the braided steel line.

## BLACK FLUID

- If the fluid in the system turns black or has debris in it, that typically means that the pushrod is not straight with the master cylinder. If the pushrod is at an angle to the master cylinder, this will cause the master cylinder to wear prematurely. The black specks are actually oxidized aluminum particles.

## CLUTCH WON'T DISENGAGE WHEN HOT, PEDAL GETS SPONGY

- If the fluid gets too hot, it can boil and create bubbles in the system. Route hydraulic lines as far away from the exhaust as possible, and shield them if needed. Make sure you are using **fresh hi-temp DOT4 brake fluid** in the system. Brake fluid that has been sitting on the shelf for a long period of time will absorb moisture from the atmosphere, even if the container is closed. Moisture in the fluid can lower the boiling point significantly.

## CLUTCH SLIPS OR DISENGAGES PREMATURELY

- You may be “upside down” on the hydraulic bearing cushion measurement. If your “X” measurement is smaller than your “Y” measurement, this will give you a negative cushion, and the pressure plate fingers are actually being depressed all the time. Double check your hydraulic bearing cushion measurements and your math.

## CSC FAILURE, CSC LEAKING FLUID, CSC HAS COME APART

- Your hydraulic bearing cushion measurement is likely too big (greater than 3/8”) OR the master cylinder pushrod is adjusted too tight and is not allowing the master cylinder to return to the fully extended position. Recheck your cushion measurements and your math, as well as the pushrod adjustment. The CSC is not able to be rebuilt. It is an OE part that we modify so that it will work with our transmissions.

**If you are still having issues, call Silver Sport Transmissions' Customer Service and Technical Support at (888) 609-0094.**